

Installation guide


Multi Ejector type CTM 6

English

Refrigerant: R744 with oil	Max. Working Pressure: 140 bar / 2031 psi	Media temp. range: -10 °C – +50 °C / 14 °F – 122 °F
Ambient temp. range: -10 °C – +50 °C / 14 °F – 122 °F	Max. OPD: 90 bar / 1305 psi Min. OPD: 0.1 bar / 1.45 psi	

Connector positions

CTM 6

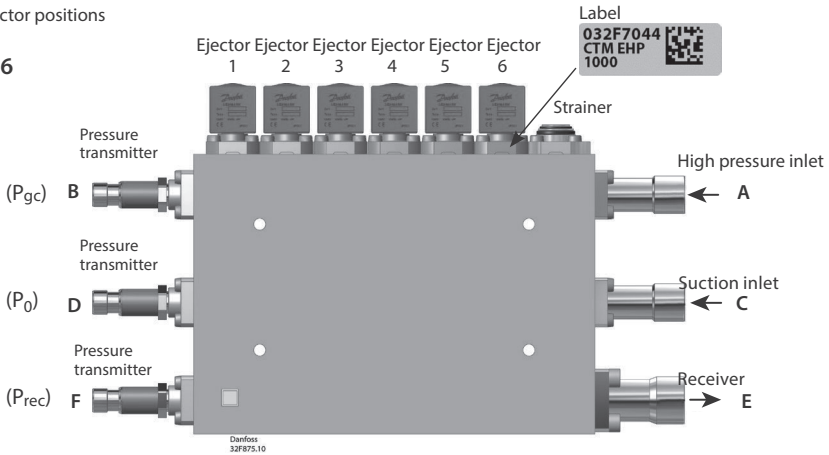


The **CTM** Multi Ejector valve is approved for use only with Danfoss controller type **AK-PC 78x**, **AK-CC 550A** or **AK-CC 750A** and **AK-SM 8xx**.

DISCLAIMER

Danfoss expressly disclaims, and any responsibility or liability, whether based on contract, breach of warranty, tort, statute or otherwise, shall be excluded, if the **CTM** Multi Ejector valve is used with any controller other than a Danfoss controller type **AK-PC 78x**, **AK-CC 550A** or **AK-CC 750A** and **AK-SM 8xx**.

For further information on **AK-PC**, please see separate document.

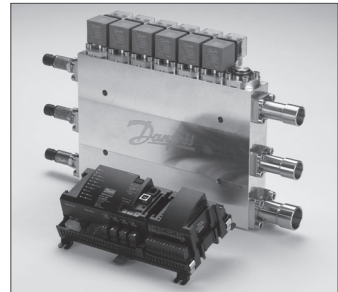


- Do not disassemble / assemble the parts unnecessarily to avoid risk of breaking the O-ring, dirt in the valve etc.
- Avoid high mechanical stress in connection with tube mounting / welding.
- Do not remove connectors during welding / brazing.

General installation


- Always place the ejector with the coils upwards so the check valve inside can use gravity to close.
- Coils available in 110-120V AC and 230V AC, 50/60Hz.
- It is recommended to place shut-off valves on all 3 connections.
- C and D connections can be moved from one side to the other if needed. Please be aware of the torque of the screws.
- Evacuating the ejector is recommended to do on the outlet and on the high pressure side.
- Pressurizing the ejector should be done from the suction side first (Suction inlet C).
- It is recommended to install ejector after suction filter (Suction inlet C).

Mounting: With coils upwards

CTM Multi Ejector needs to be fixed to the rack frame using 4 holes in the aluminum block do avoid stress on the connectors

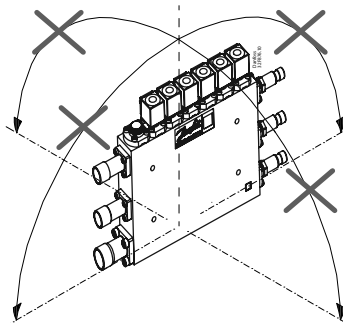

Brazing

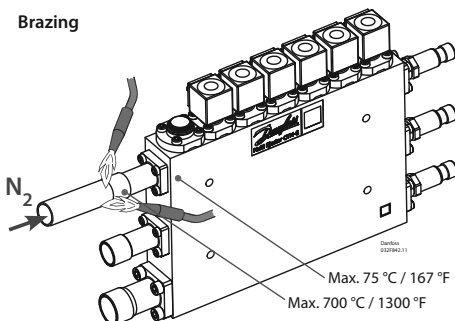


Recommendation for brazing

Recommendation: brazing nozzle 4 - 6 mm ($\frac{5}{32}$ in - $\frac{15}{64}$ in)

Materials used for brazing:

- Flux: Metalli tenacity No. 5 Powder or Braze Tec special h paste.
- Filler: Silver-Flo 55 (BS:AG 14/ DIN L-Ag55 Sn) or Silver-Flo 56 (AWS B Ag-7).

Welding

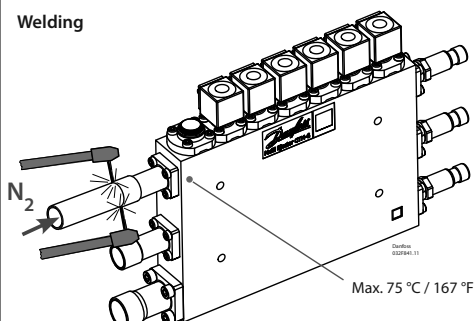


Recommendation for TIG welding

- Power approximately 60 A.
- Use Shield gas charge - Argon.
- Material for welding - approximately 2 mm thick stainless steel alloy.




Warning: Filler metals containing Phosphor i.e. BS: CP 1/ DIN L-Ag 15P or BS: CP 3/ DIN L-Ag P7 must not be used.

Coil

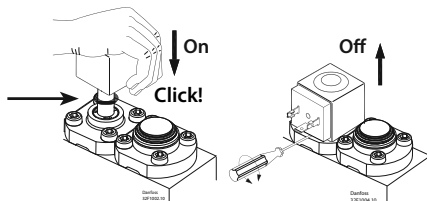

Warning


Be sure that the O-ring is in place.

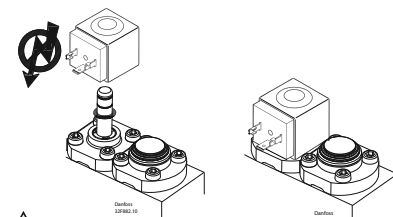

Warning

Never switch on power to the coil when it is dismantled from the valve. There is a danger the coil may be damaged and a risk of injuries and burns.

Mounting DIN plug / LED DIN plug.

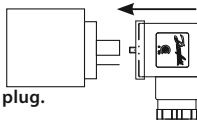

Armature tubes are sensitive and have to be protected during the installation:

- do not damage the armature tubes with strokes or forces
- do not lift or handle the block by lifting the armature tubes etc.
- avoid pull-forces on the wires connected to the coils

Starting up /Operation:

Opening sequence:

- 1 - connector A
- 2 - connector C
- 3 - connector E

Follow the opening sequence to avoid too high NRV differential pressure.



Starting up the system: open all connection ball valves slowly (avoiding liquid hammer that can damage internal check valve (NRV) and build-in strainer.

It is mandatory to clean the strainer after 2 days of running the system. O-rings needs to be replaced with the two new ones placed on the strainer top. Removed O-rings to be placed on the strainer top and reused after return to initial shape during next strainer maintenance. Strainer cleanliness is important for proper operation of Multi Ejector and the cleaning shall be repeated if necessary every 2-3 weeks to remove the dirt circulating in the system.

Service

Mounting and service of ejectors


Liquid ejectors* and then high pressure ejectors with the highest capacities (longest ejectors) must be placed closest to the suction connector C.

Any blank ejector must be placed closest to the suction connector C.

*aplicable only for CTM 6 Combi

For mounting of pressure transmitter

MBS 8250 (064G1136)

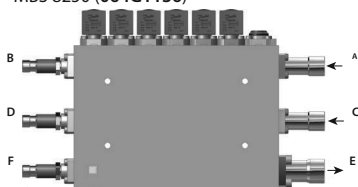

Warning:

Do not disassemble / assemble the parts unnecessarily to avoid risk of breaking the O-ring, dirt in the valve etc.

A: Inlet connector

Gas cooler outlet - Ball valve - inlet connector
Combi brazing $\frac{7}{8}$ inch ODF - weld $\frac{3}{4}$ inch (EN10220)

B: Inlet measurement port G $\frac{7}{16}$ inch - 20 UNF

C: Suction connector

MT evaporator outlet - Ball valve - suction connector
Combi brazing $\frac{7}{8}$ inch ODF - weld $\frac{3}{4}$ inch (EN10220)


D: Suction measurement port G $\frac{7}{16}$ inch - 20 UNF

E: Outlet connector

Outlet connector - Ball valve - Receiver
Combi brazing 1 inch ODF - weld $1\frac{1}{8}$ inch (EN10220)

F: Outlet measurement port G $\frac{7}{16}$ inch - 20 UNF

Pressure transmitter connections

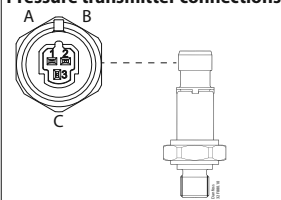

Pressure transmitter
Type MBS 8250

Ratiometric
Pin 1 (A): + supply
Pin 2 (B): - supply/common
Pin 3 (C): output


Insulation of Multi Ejector

Requirements for materials used for insulation:

- has to be based on a synthetic rubber base or ex Polyurethane
- water vapor diffusion resistance number $\mu \leq 7000$


- thermal conductivity $\leq 0,033$ W/(m·K)
 - insulations material thickness ≥ 5 mm
 - for use at low temperature -10°C or lower
 - for use at high temperature $+50^{\circ}\text{C}$ or higher
 - glue or adhesive made of Poly chloroprene or it is Silicone type
- Do not insulate the coils of Multi Ejector

Exchange of connectors and pressure transmitters




Tightening sequence

Torque 6 mm screws: $10 \text{ Nm} \pm 1 \text{ Nm}$




Allen key 5 mm

Torque 6 mm screws: $10 \text{ Nm} \pm 1 \text{ Nm}$




Allen key 5 mm

Torque 8 mm screws: $27.5 \text{ Nm} \pm 2.5 \text{ Nm}$




Allen key 6 mm

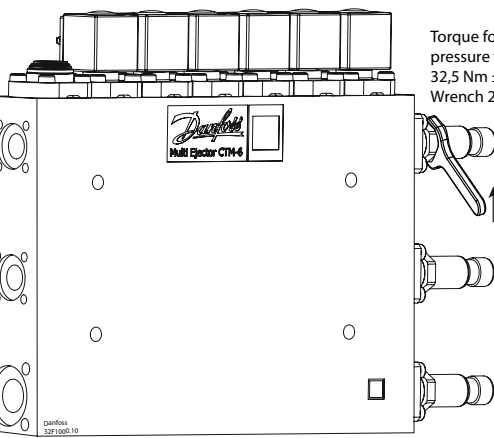

Torque for mounting
pressure transmitters
 $32,5 \text{ Nm} \pm 2,5$
Wrench 22 mm

Service

Service on strainer

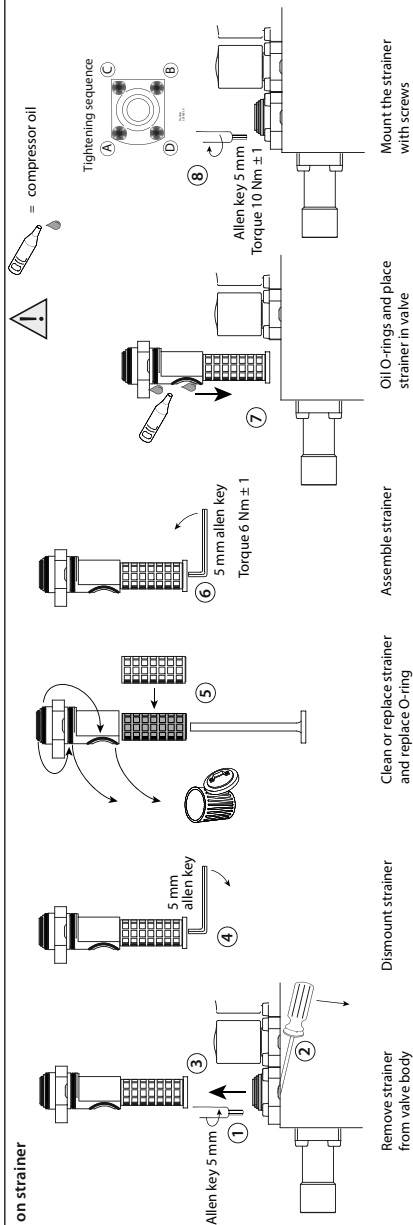

Service on ejector

